

FORD:

2005 Mustang

ISSUE

Some 2005 Mustang vehicles built before 3/8/2005 may exhibit occasional brake noise during light to moderate decelerations from speeds below 40 MPH (64 Km/h), often described as a high-pitched squeal or screech.

ACTION

Install revised rear brake linings following procedures in Workshop Manual Section 206-04. Do not replace or turn rotors, and do not service the front brakes for this condition.

PART NUMBER	PART NAME
5R3Z-2200-B	Disc Brake Lining

WARRANTY STATUS: Eligible Under Provisions Of
New Vehicle Limited
Warranty Coverage

OPERATION	DESCRIPTION	TIME
051810A	2005 Mustang - Install Revised Rear Disc Brake Linings (Do Not Use With 2001BBB, 2001B1BB)	0.6 Hr.

DEALER CODING

BASIC PART NO.
2200

CONDITION
CODE
42

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford, Lincoln, or Mercury dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supercede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.